CBR1000F

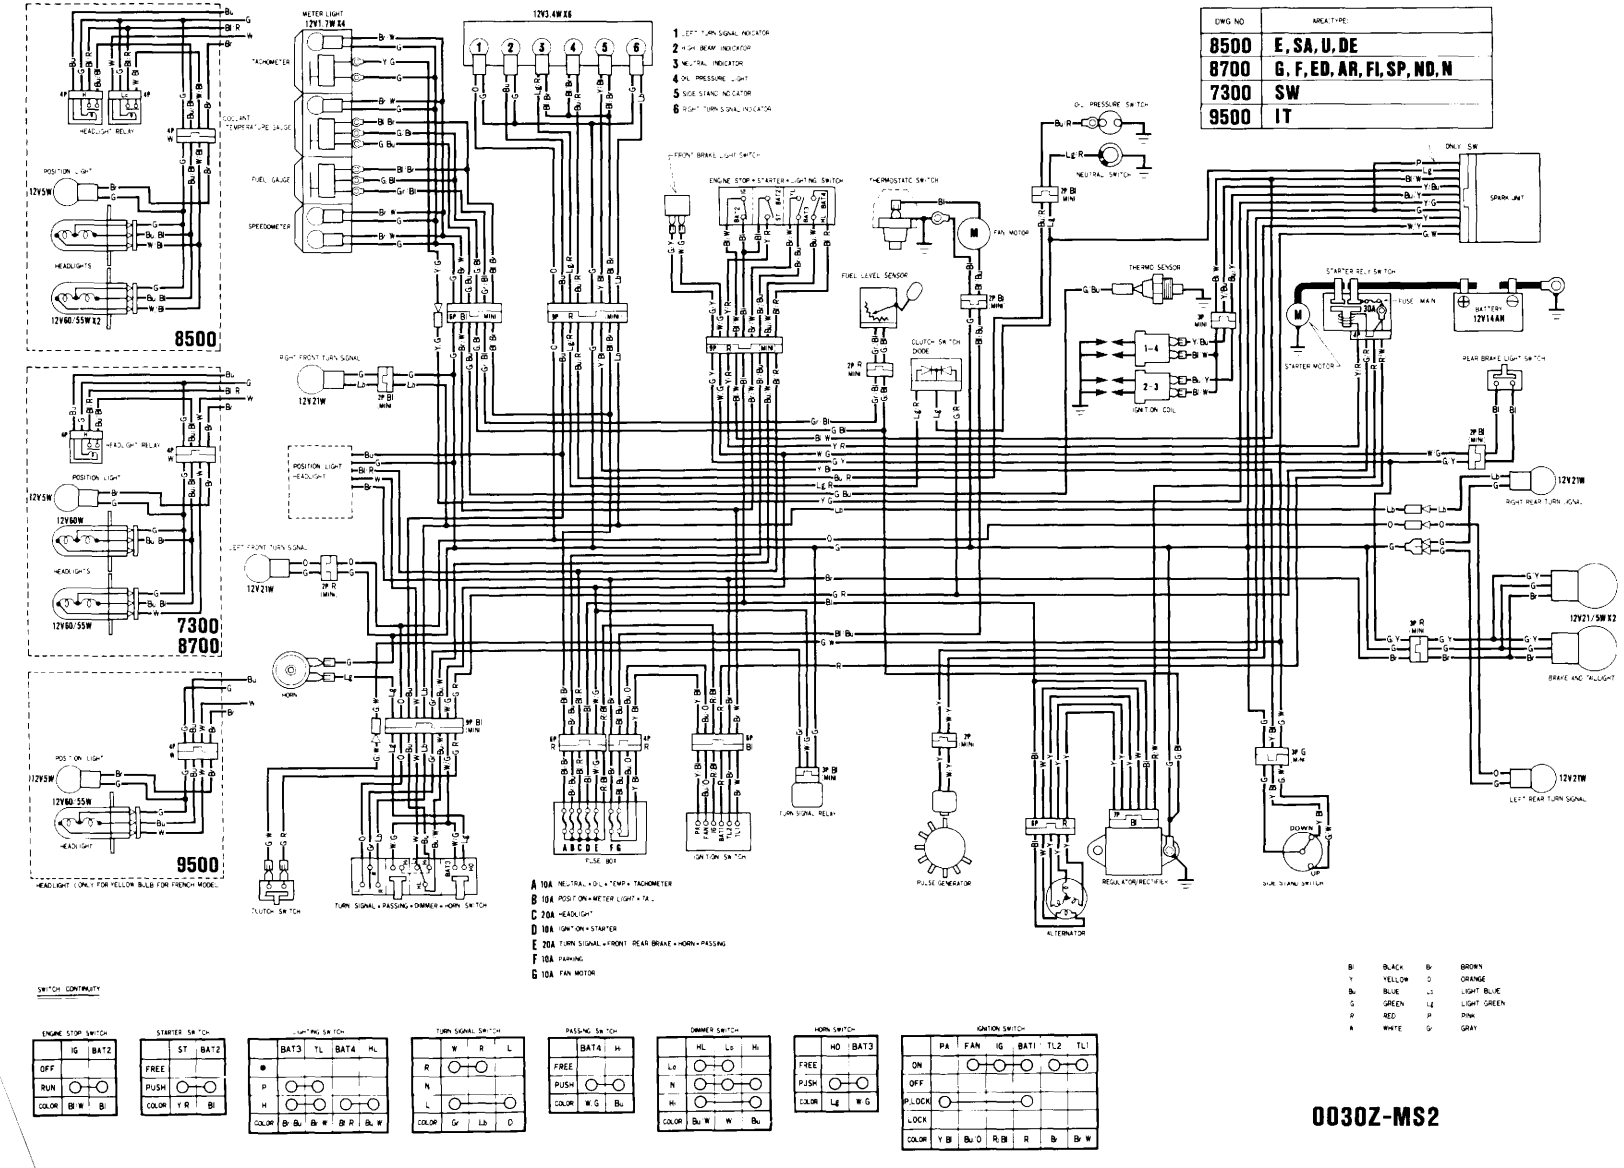
DWG NO | AREA TYPE
8500 | E, SA, U, DE
8700 | G, F, ED, AR, FI, SP, ND, N
7300 | SW
9500 | IT
1 LEFT TURN SIGNAL INDICATOR
2 HIGH BEAM INDICATOR
3 NEUTRAL INDICATOR
4 OIL PRESSURE LIGHT
5 SIDE STAND INDICATOR
6 RIGHT TURN SIGNAL INDICATOR
12V3.4W X6
METER LIGHT 12V1.7W X4
TACHOMETER
COOLANT TEMPERATURE GAUGE
FUEL GAUGE
SPEEDOMETER
HEADLIGHT RELAY
POSITION LIGHT 12V5W
HEADLIGHTS 12V60/55W X2
8500
HEADLIGHTS 12V60/55W
7300
8700
HEAD LIGHT 12V60/55W
9500
HEADLIGHT (ONLY FOR YELLOW BULB FOR FRENCH MODEL)
RIGHT FRONT TURN SIGNAL 12V21W
LEFT FRONT TURN SIGNAL 12V21W
POSITION LIGHT HEADLIGHT
HORN
CLUTCH SWITCH
TURN SIGNAL • PASSING • DIMMER • HORN SWITCH
FUSE BOX
A B C D E F G
IGNITION SWITCH
FRONT BRAKE LIGHT SWITCH
ENGINE STOP • STARTER • LIGHTING SWITCH
THERMOSTATIC SWITCH
FAN MOTOR
FUEL LEVEL SENSOR
CLUTCH SWITCH DIODE
TURN SIGNAL RELAY
PULSE GENERATOR
OIL PRESSURE SWITCH
NEUTRAL SWITCH
THERMO SENSOR
IGNITION COIL
ALTERNATOR
REGULATOR/RECTIFIER
SIDE STAND SWITCH
DOWN
UP
IT ONLY SW
SPARK UNIT
STARTER RELAY SWITCH
FUSE MAIN 30A
BATTERY 12V14AH
STARTER MOTOR
REAR BRAKE LIGHT SWITCH
RIGHT REAR TURN SIGNAL 12V21W
BRAKE AND TAILLIGHT 12V21/5W X2
LEFT REAR TURN SIGNAL 12V21W
A 10A NEUTRAL • OIL • TEMP • TACHOMETER
B 10A POSIT ON • METER LIGHT • TAIL
C 20A HEADLIGHT
D 10A IGNITION • STARTER
E 20A TURN SIGNAL • FRONT REAR BRAKE • HORN • PASSING
F 10A PARKING
G 10A FAN MOTOR
SWITCH CONTINUITY
ENGINE STOP SWITCH
STARTER SWITCH
LIGHTING SWITCH
TURN SIGNAL SWITCH
PASSING SW TCH
DIMMER SWITCH
HORN SWITCH
IGNITION SWITCH
Bl BLACK
Br BROWN
Y YELLOW
O ORANGE
Bu BLUE
Lb LIGHT BLUE
G GREEN
Lg LIGHT GREEN
R RED
P PINK
W WHITE
Gr GRAY
0030Z-MS2