


Carburetor

Refer to *Safety Precautions* on page 47.

Engine Idle Speed

RIGHT SIDE

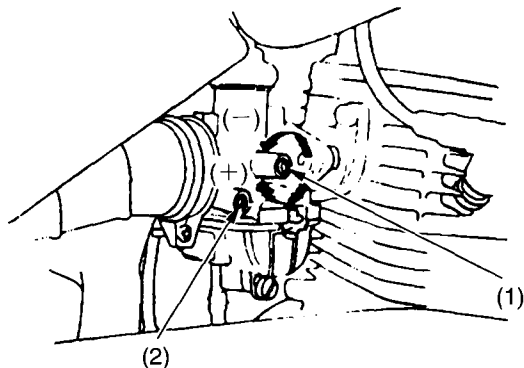

(1) throttle stop screw
(2) air screw

(+) increase rpm
(-) decrease rpm

The engine must be at normal operating temperature for accurate idle speed adjustment. Support the motorcycle upright on a firm, level surface after warm-up.

The best way to set the idle speed is with a tachometer. The instructions follow. However, you can approximate the correct idle speed by adjusting the screw in or out until the engine idles smoothly, without stalling.

1. Shift to neutral after warming up the engine.
2. Connect a tachometer, following the tachometer manufacturer's instructions.
3. Adjust idle speed with the throttle stop screw (1).

Idle Speed: $1,500 \pm 100$ rpm