


Drive Chain

5. With the upper or lower section of drive chain tight between the sprockets measure the distance between a span of 21 pins from pin center to pin center. If the distance exceeds the service limit, the chain is worn out and should be replaced.

Service limit:

10.6 in (268 mm)



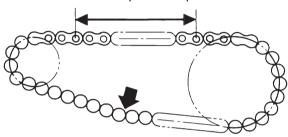

(cont'd)

Servicing Your Honda 137

